

Work Order ID 133247

Thursday, May 28, 2015 7:22:27 AM

133247

U/R

OK *q* 15/6/9 Page 1

Item ID: D119-646-041

Accept

N900040100

Setup Start ***NS1***

Revision ID: U/R - URF15-560

Item Name: Replacement Skidtube with Wearpads, Fits LH or RH

Stop ***NS2***

Start Date: 5/28/2015 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 5/28/2015 Req'd Qty: 1.00 ***1***

Customer:

Reference:

Approvals: Process Plan: ML5 Date: MAY 28 2015 Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
Draw Nbr	Revision Nbr								
D3887-041	D								
IIN-D119-646	C								

100

0.00

100

DC

Doc.Control -USB or Paperwork

Memo

0.00

Photocopy bluefile & type labels per PPP D119-646-041

CHG003

1 *945*
8/89

B
75-66-09

110

0.00

110

Skidtubes

Skidtubes

Memo

0.00

1- inspect Mat'L D2500-1-190 for damage

2-Cut tube to length as per dwg D3887 (154.8")

3- Ensure squareness of ends and scribe batch#

>

1 *0* *15-6-1* *Doc* *JH*

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY			
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐
Past Expiry Date ☐	Manufacturing Process ☐				
Misidentified ☐	Past Due ☐	OTHER :			

Work Order ID 133247

Thursday, May 28, 2015 7:22:27 AM


133247

Page 2

Item ID: D119-646-041 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: U/R - URF15-560 Stop ***NS2***
Item Name: Replacement Skidtube with Wearpads, Fits LH or RH
Start Date: 5/28/2015 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 5/28/2015 Req'd Qty: 1.00 ***1*** Customer:
Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Run Start ***NR1***
Stop ***NR2***

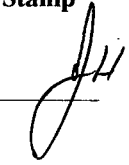Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
120	Chemical Conversion Coat per QSI005 4.1	0.00							
120									
HandFinish	Memo	0.00				1	0	15-6-1	
Hand Finishing									
121	QC7-Inspect Chemical Conversion Coat	0.00							
121									
QC	Memo	0.00				1	0	15-6-1	
Quality Control									
122	QC5- Inspect part completeness to step on W/O	0.00							
122									
QC	Memo	0.00				1	0	15-6-1	
Quality Control									

DAS
18
9-89

DAS
18
9-89

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐
OTHER : ☐					

Work Order ID 133247

Thursday, May 28, 2015 7:22:27 AM

133247

Page 3

Item ID: D119-646-041 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: U/R - URF15-560 Stop ***NS2***
Item Name: Replacement Skidtube with Wearpads, Fits LH or RH
Start Date: 5/28/2015 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 5/28/2015 Req'd Qty: 1.00 ***1*** Customer:
Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

130

130

Skidtubes

Skidtubes

Memo

0.00

1- Install drill Jig DT9477 drill X-bolt spacer pilot holes using 3/16" drill first side only.

2- 2nd side, locating from first saddle holes use DT9861 A/B to drill 2nd side fwd saddle holes.

3- 2nd side locating from fwd saddle drill remaining crossbolt spacer holes using DT9477


4- Open crossbolt spacer holes to finished size as per dwg D3887 (section D-D and E-E) ***DO NOT OPEN FWD Saddles Holes***

5- Deburr, blow out chips from inside of tube.

6- Bond web in place as per Dwg D3887 & QSI 015.

A/RSikaflex-291 131579Sikaflex expire date: 5-10-21Start: 3:30 Time: _____Finish: 3:30 Time: _____

***** (Adhere for 12 hours) *****

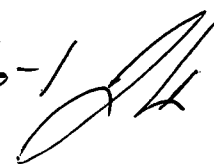15-6-1 

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width:100%; border: none;"> <tr> <td style="border: none;">Skid-tube ☐</td> <td style="border: none;">Cross tube ☐</td> <td style="border: none;">Water Jet ☐</td> <td style="border: none;">Engineering ☐</td> </tr> <tr> <td style="border: none;">Machining ☐</td> <td style="border: none;">Small Fab ☐</td> <td style="border: none;">Prod. Eng. Coord. ☐</td> <td style="border: none;">Quality ☐</td> </tr> <tr> <td style="border: none;">Thermoforming ☐</td> <td style="border: none;">Finishing ☐</td> <td style="border: none;">Rec/Store/Packaging ☐</td> <td style="border: none;">Other ☐</td> </tr> <tr> <td style="border: none;">Large Fab ☐</td> <td style="border: none;">Composite ☐</td> <td style="border: none;">Supplier ☐</td> <td></td> </tr> </table>				Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐																		
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐																		
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐																		
Large Fab ☐	Composite ☐	Supplier ☐																			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval																	
Description Work Order Deviation			Disposition																		
			Completed By																		
			Lead hand / Supervisor Approval Verification																		
			QC / QA Coordinator Approval																		
Root Cause		FAULT CATEGORY																			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐																
OTHER :																					

Work Order ID 133247

133247

Page 4

Thursday, May 28, 2015 7:22:27 AM

Item ID: D119-646-041 Accept *N900040100* Setup Start *NS1*
 Revision ID: U/R - URF15-560 Stop *NS2*
 Item Name: Replacement Skidtube with Wearpads, Fits LH or RH
 Start Date: 5/28/2015 Start Qty: 1.00 *1* Cust Item ID:
 Required Date: 5/28/2015 Req'd Qty: 1.00 *1* Customer:
 Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start *NR1*
 QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop *NR2*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

135	QC5- Inspect part completeness to step on W/O	0.00							
-----	---	------	--	--	--	--	--	--	--

135

QC

Memo

Quality Control

0.00

DAS
18
8-89

1 0 15-06-02

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS <table style="width:100%; border: none;"> <tr> <td style="width:12.5%;">Skid-tube ☐</td> <td style="width:12.5%;">Cross tube ☐</td> <td style="width:12.5%;">Water Jet ☐</td> <td style="width:12.5%;">Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>						Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐																						
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐																						
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐																						
Large Fab ☐	Composite ☐	Supplier ☐																							
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval																		
Description Work Order Deviation				Disposition																					
Root Cause		FAULT CATEGORY																							
Environment ☐	☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐																			
Design ☐	☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐																			
Doc/Data ☐	☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐																			
Equip/Tooling ☐	☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐																			
Handling/Pre ☐	☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐																			
Material ☐	☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐																			
Internal Transport ☐	☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐																			
Tribal Knowledge ☐	☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐																			
LOA ☐	☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐																			
Substation ☐	☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐																			
Past Expiry Date ☐	☐	Manufacturing Process ☐	OTHER : _____																						
Misidentified ☐	☐	Past Due ☐																							

Work Order ID 133247

Thursday, May 28, 2015 7:22:27 AM

133247

Page 5

Item ID: D119-646-041

Accept

N900040100Setup Start ***NS1***

Revision ID: U/R - URF15-560

Stop ***NS2***

Item Name: Replacement Skidtube with Wearpads, Fits LH or RH

Start Date: 5/28/2015 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 5/28/2015 Req'd Qty: 1.00 ***1***

Customer:

Reference: 7

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

140

140

Skidtubes

Skidtubes

Memo

0.00

1- Bend FWD end of tube using bender 1 and bend prog. D3887.***Must use bending aid DT9544, ensure proper positioning***

2- Cut FWD end of tube as per dwg D3887.***Verify measurement***

3- Buff out marks left from bending

4- Drill FWD cap holes using DT8215. Open FWD & AFT cap holes to 0.208"

5- Open FWD saddle holes to finished size as per dwg D3887

6- Drill FWD x-bolt spacer holes using DT9816 and open to finished size.(verify measurement)

7- Drill Tow ring hole, using DT10047 locate from FWD saddle hole. (verify measurement). Open to finished size.


8- Drill 1.87" and 3.74 holes using DT10045 A&B locate from FWD saddle hole. (verify measurement) as per dwg.

9- C'sink FWD cap hole as per detail "C"

10- Drill holes for wearpads using DT8931, open to 0.297".

11- Countersink crossbolt spacer holes, and prepare tube for welding, deburr.

12- Deburr and blow out chips from inside of tube.

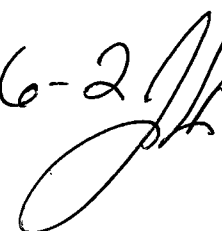15-6-2


DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : ☐					

Work Order ID 133247

Thursday, May 28, 2015 7:22:27 AM

133247

Page 6

Item ID: D119-646-041 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: U/R - URF15-560 Stop ***NS2***
Item Name: Replacement Skidtube with Wearpads, Fits LH or RH
Start Date: 5/28/2015 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 5/28/2015 Req'd Qty: 1.00 ***1*** Customer:
Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

150 QC5- Inspect part completeness to step on W/O 0.00

150

QC

Memo

0.00

Quality Control

**DAS
18
9-89**1 0 15-06-03

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width:100%; border: none;"> <tr> <td style="border: none;">Skid-tube ☐</td> <td style="border: none;">Cross tube ☐</td> <td style="border: none;">Water Jet ☐</td> <td style="border: none;">Engineering ☐</td> </tr> <tr> <td style="border: none;">Machining ☐</td> <td style="border: none;">Small Fab ☐</td> <td style="border: none;">Prod. Eng. Coord. ☐</td> <td style="border: none;">Quality ☐</td> </tr> <tr> <td style="border: none;">Thermoforming ☐</td> <td style="border: none;">Finishing ☐</td> <td style="border: none;">Rec/Store/Packaging ☐</td> <td style="border: none;">Other ☐</td> </tr> <tr> <td style="border: none;">Large Fab ☐</td> <td style="border: none;">Composite ☐</td> <td style="border: none;">Supplier ☐</td> <td></td> </tr> </table>				Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐																																																			
Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐																																																																				
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐																																																																				
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐																																																																				
Large Fab ☐	Composite ☐	Supplier ☐																																																																					
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval																																																																			
Description Work Order Deviation			Disposition																																																																				
						Completed By																																																																	
						Lead hand / Supervisor Approval Verification																																																																	
			QC / QA Coordinator Approval																																																																				
Root Cause <table style="width:100%; border: none;"> <tr> <td style="border: none;">Environment ☐</td> <td style="border: none;">No Re-verification ☐</td> <td style="border: none;">Pressure/Forced ☐</td> </tr> <tr> <td style="border: none;">Design ☐</td> <td style="border: none;">Operator ☐</td> <td style="border: none;">Bending ☐</td> </tr> <tr> <td style="border: none;">Doc/Data ☐</td> <td style="border: none;">Offset/Setup ☐</td> <td style="border: none;">Centre Not Concentric ☐</td> </tr> <tr> <td style="border: none;">Equip/Tooling ☐</td> <td style="border: none;">Supplier ☐</td> <td style="border: none;">Cracks ☐</td> </tr> <tr> <td style="border: none;">Handling/Pre ☐</td> <td style="border: none;">Training ☐</td> <td style="border: none;">Crimp/Kink/Ripple/Wave ☐</td> </tr> <tr> <td style="border: none;">Material ☐</td> <td style="border: none;">Use for Testing ☐</td> <td style="border: none;">Cuffs ☐</td> </tr> <tr> <td style="border: none;">Internal Transport ☐</td> <td style="border: none;">Poor Information ☐</td> <td style="border: none;">Crushing ☐</td> </tr> <tr> <td style="border: none;">Tribal Knowledge ☐</td> <td style="border: none;">Rushing ☐</td> <td style="border: none;">Heat Treat ☐</td> </tr> <tr> <td style="border: none;">LOA ☐</td> <td style="border: none;">Product Improvement ☐</td> <td style="border: none;">Wave/Twist in Tube ☐</td> </tr> <tr> <td style="border: none;">Substation ☐</td> <td style="border: none;">Process Improvement ☐</td> <td style="border: none;">Marks/Chatter ☐</td> </tr> <tr> <td style="border: none;">Past Expiry Date ☐</td> <td style="border: none;">Manufacturing Process ☐</td> <td></td> </tr> <tr> <td style="border: none;">Misidentified ☐</td> <td style="border: none;">Past Due ☐</td> <td></td> </tr> </table>			Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Design ☐	Operator ☐	Bending ☐	Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	Equip/Tooling ☐	Supplier ☐	Cracks ☐	Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Material ☐	Use for Testing ☐	Cuffs ☐	Internal Transport ☐	Poor Information ☐	Crushing ☐	Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Past Expiry Date ☐	Manufacturing Process ☐		Misidentified ☐	Past Due ☐		FAULT CATEGORY <table style="width:100%; border: none;"> <tr> <td style="border: none;">Temperature/Cure ☐</td> <td style="border: none;">Power Loss/Surge ☐</td> <td style="border: none;">Positioned Wrong ☐</td> </tr> <tr> <td style="border: none;">Set-up ☐</td> <td style="border: none;">Folio/Program ☐</td> <td style="border: none;">Outside Dimensions ☐</td> </tr> <tr> <td style="border: none;">BOM/Route ☐</td> <td style="border: none;">Grain ☐</td> <td style="border: none;">Over/Under tolerance ☐</td> </tr> <tr> <td style="border: none;">Broken/Damage/Defect ☐</td> <td style="border: none;">Weld ☐</td> <td style="border: none;">Part Incorrect ☐</td> </tr> <tr> <td style="border: none;">Inspection Incomplete/Unqualified ☐</td> <td style="border: none;">Wrong Stock Pulled ☐</td> <td style="border: none;">Part Lost/Missing ☐</td> </tr> <tr> <td style="border: none;">Contamination ☐</td> <td style="border: none;">Out of Sequence ☐</td> <td style="border: none;">Part Moved ☐</td> </tr> <tr> <td style="border: none;">Countersink ☐</td> <td style="border: none;">Off-set ☐</td> <td style="border: none;">Drawing ☐</td> </tr> <tr> <td style="border: none;">Cut Too Short ☐</td> <td style="border: none;">Mislabeled ☐</td> <td style="border: none;">Finish ☐</td> </tr> <tr> <td style="border: none;">Instructions Incomplete/Unclear ☐</td> <td style="border: none;">Fit/Function ☐</td> <td style="border: none;">Misread ☐</td> </tr> <tr> <td style="border: none;">Drill Holes ☐</td> <td style="border: none;">Misaligned/off center ☐</td> <td style="border: none;">Turning Sequence ☐</td> </tr> </table>			Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	Countersink ☐	Off-set ☐	Drawing ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐
Environment ☐	No Re-verification ☐	Pressure/Forced ☐																																																																					
Design ☐	Operator ☐	Bending ☐																																																																					
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐																																																																					
Equip/Tooling ☐	Supplier ☐	Cracks ☐																																																																					
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐																																																																					
Material ☐	Use for Testing ☐	Cuffs ☐																																																																					
Internal Transport ☐	Poor Information ☐	Crushing ☐																																																																					
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐																																																																					
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐																																																																					
Substation ☐	Process Improvement ☐	Marks/Chatter ☐																																																																					
Past Expiry Date ☐	Manufacturing Process ☐																																																																						
Misidentified ☐	Past Due ☐																																																																						
Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐																																																																					
Set-up ☐	Folio/Program ☐	Outside Dimensions ☐																																																																					
BOM/Route ☐	Grain ☐	Over/Under tolerance ☐																																																																					
Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐																																																																					
Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐																																																																					
Contamination ☐	Out of Sequence ☐	Part Moved ☐																																																																					
Countersink ☐	Off-set ☐	Drawing ☐																																																																					
Cut Too Short ☐	Mislabeled ☐	Finish ☐																																																																					
Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐																																																																					
Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐																																																																					
OTHER : ☐																																																																							

Work Order ID 133247

Thursday, May 28, 2015 7:22:27 AM

133247

Page 7

Item ID: D119-646-041 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: URF - URF15-560 Stop ***NS2***
Item Name: Replacement Skidtube with Wearpads, Fits LH or RH
Start Date: 5/28/2015 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 5/28/2015 Req'd Qty: 1.00 ***1*** Customer:
Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
160		0.00							

160

Skidtubes

Skidtubes

Memo

0.00

NOTE:TACK IN 2 MOST FWD X-BOLT SPACERS AND TEST FIT FWD
GROUND HANDELING FIXTURE,IF FIXTURE FITS WELL THEN
PROCEED. FIXTURE DT10091.

1-Insert crossbolt spacers. Weld as per QSI 004 and Dwg D3887. Remember to
back drill each hole before welding the other side. Use aluminum rod
A/RAluminum Rod M127865

2-Grind cross bolt welds flush as per Dwg D3887. Ensure no pin hole.

3-Counterbore 5/16" x 0.750" deep as per Dwg D3887.

4- Deburr & Scribe batch # on Aft end of tube.

BE15-06-03

170

QC5- Inspect part completeness to step on W/O

0.00

170

QC

Quality Control

Memo

0.00

TEST FIT USING FIXTURE DT10091.

BE15-06-03

① 1506-03 AD

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :				MRB (QSI042) Approval	
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER :							
Misidentified ☐	Past Due ☐								

Work Order ID 133247

Thursday, May 28, 2015 7:22:27 AM

133247

Page 8

Item ID: D119-646-041 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: U/R - URF15-560 Stop ***NS2***
Item Name: Replacement Skidtube with Wearpads, Fits LH or RH
Start Date: 5/28/2015 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 5/28/2015 Req'd Qty: 1.00 ***1*** Customer:
Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
180	QC10- Inspect visual per QSI004- ground welds	0.00							
180									
QC	Memo	0.00							① 150603 PD
Quality Control									
190	Pressure Wash per QSI005 4.3	0.00							
190									
HandFinish	Memo	0.00							1 15-6-4 JH
Hand Finishing	Re-alodine tube as per QSI 005 section 4.1.2.1 do not acid etch.								
200	White Gloss(Ref:4.3.5.1) per QSI005 4.3-Alum	0.00							
200									
Powdercoat	Memo	0.00							1 φ 15-6-4 DS 34 9-89
Powder Coating	START TIME: 11:30 OVEN TEMPERATURE: 820° FINISH TIME: 12:00								

P.T.O.

DQA: Set Date: 15/06/30



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: RAM Date: 15/06/22

Work Order update only ☒

Work Order: <u>133247</u> Part No. <u>D119-646-041</u> NCR No. <u>15-5116</u>		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☒ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS <table border="0"> <tr> <td>Skid-tube ☐</td> <td>Cross tube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☒</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>						Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☒	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐																																																		
Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐																																																																							
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐																																																																							
Thermoforming ☐	Finishing ☒	Rec/Store/Packaging ☐	Other ☐																																																																							
Large Fab ☐	Composite ☐	Supplier ☐																																																																								
Date: <u>15.05.29</u>		Step #: <u>200</u>		QTY Effective: <u>1</u>			MRB (QSI042) Approval <u>A.P.</u> <u>15.05.29</u>																																																																			
Description Work Order Deviation				Disposition				Completed By <u>838</u> <u>15-6-16</u>																																																																		
NO POWDER COAT IN SADDLE LOCATIONS IN ACCORDANCE WITH ATTACHED DWG. ALODINE ONLY				ACCEPTABLE				Lead hand / Supervisor Approval Verification <u>15.06.03</u> <u>PD</u>																																																																		
								QC / QA Coordinator Approval <u>15.06.03</u> <u>PD</u>																																																																		
Root Cause <table border="0"> <tr> <td>Environment ☐</td> <td>No Re-verification ☐</td> <td rowspan="10" style="writing-mode: vertical-rl; transform: rotate(180deg);">Customer request</td> <td>Pressure/Forced ☐</td> <td>Temperature/Cure ☐</td> <td>Power Loss/Surge ☐</td> <td>Positioned Wrong ☐</td> </tr> <tr> <td>Design ☒</td> <td>Operator ☐</td> <td>Bending ☐</td> <td>Set-up ☐</td> <td>Folio/Program ☐</td> <td>Outside Dimensions ☐</td> </tr> <tr> <td>Doc/Data ☒</td> <td>Offset/Setup ☐</td> <td>Centre Not Concentric ☐</td> <td>☒ BOM/Route</td> <td>Grain ☐</td> <td>Over/Under tolerance ☐</td> </tr> <tr> <td>Equip/Tooling ☐</td> <td>Supplier ☐</td> <td>Cracks ☐</td> <td>Broken/Damage/Defect ☐</td> <td>Weld ☐</td> <td>Part Incorrect ☐</td> </tr> <tr> <td>Handling/Pre ☐</td> <td>Training ☐</td> <td>Crimp/Kink/Ripple/Wave ☐</td> <td>Inspection Incomplete/Unqualified ☐</td> <td>Wrong Stock Pulled ☐</td> <td>Part Lost/Missing ☐</td> </tr> <tr> <td>Material ☐</td> <td>Use for Testing ☐</td> <td>Cuffs ☐</td> <td>Contamination ☐</td> <td>Out of Sequence ☐</td> <td>Part Moved ☐</td> </tr> <tr> <td>Internal Transport ☐</td> <td>Poor Information ☐</td> <td>Crushing ☐</td> <td>Countersink ☐</td> <td>Off-set ☐</td> <td>Drawing ☐</td> </tr> <tr> <td>Tribal Knowledge ☐</td> <td>Rushing ☐</td> <td>Heat Treat ☐</td> <td>Cut Too Short ☐</td> <td>Mislabeled ☐</td> <td>☒ Finish</td> </tr> <tr> <td>LOA ☐</td> <td>Product Improvement ☐</td> <td>Wave/Twist in Tube ☐</td> <td>Instructions Incomplete/Unclear ☐</td> <td>Fit/Function ☐</td> <td>Misread ☐</td> </tr> <tr> <td>Substation ☐</td> <td>Process Improvement ☐</td> <td>Marks/Chatter ☐</td> <td>Drill Holes ☐</td> <td>Misaligned/off center ☐</td> <td>Turning Sequence ☐</td> </tr> </table>				Environment ☐	No Re-verification ☐	Customer request	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Design ☒	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	Doc/Data ☒	Offset/Setup ☐	Centre Not Concentric ☐	☒ BOM/Route	Grain ☐	Over/Under tolerance ☐	Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	☒ Finish	LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐	FAULT CATEGORY <table border="0"> <tr> <td>Past Expiry Date ☐</td> <td>Manufacturing Process ☐</td> <td>OTHER: <u>customer request</u></td> </tr> <tr> <td>Misidentified ☐</td> <td>Past Due ☐</td> <td></td> </tr> </table>				Past Expiry Date ☐	Manufacturing Process ☐	OTHER: <u>customer request</u>	Misidentified ☐	Past Due ☐	
Environment ☐	No Re-verification ☐	Customer request	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐		Positioned Wrong ☐																																																																			
Design ☒	Operator ☐		Bending ☐	Set-up ☐	Folio/Program ☐		Outside Dimensions ☐																																																																			
Doc/Data ☒	Offset/Setup ☐		Centre Not Concentric ☐	☒ BOM/Route	Grain ☐		Over/Under tolerance ☐																																																																			
Equip/Tooling ☐	Supplier ☐		Cracks ☐	Broken/Damage/Defect ☐	Weld ☐		Part Incorrect ☐																																																																			
Handling/Pre ☐	Training ☐		Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐		Part Lost/Missing ☐																																																																			
Material ☐	Use for Testing ☐		Cuffs ☐	Contamination ☐	Out of Sequence ☐		Part Moved ☐																																																																			
Internal Transport ☐	Poor Information ☐		Crushing ☐	Countersink ☐	Off-set ☐		Drawing ☐																																																																			
Tribal Knowledge ☐	Rushing ☐		Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐		☒ Finish																																																																			
LOA ☐	Product Improvement ☐		Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐		Misread ☐																																																																			
Substation ☐	Process Improvement ☐		Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐																																																																				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER: <u>customer request</u>																																																																								
Misidentified ☐	Past Due ☐																																																																									

Work Order ID 133247

Thursday, May 28, 2015 7:22:27 AM

133247

Page 9

Item ID: D119-646-041 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: U/R - URF15-560 Stop ***NS2***
Item Name: Replacement Skidtube with Wearpads, Fits LH or RH
Start Date: 5/28/2015 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 5/28/2015 Req'd Qty: 1.00 ***1*** Customer:
Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Run Start ***NR1***
Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
210	QC3- Inspect Part Finish	0.00							
210									
QC	Memo	0.00							
Quality Control									
220		0.00							
220									
HandFinish	Memo	0.00							
Hand Finishing	1-Install inserts as per Dwg D3887.								
230	QC5- Inspect part completeness to step on W/O	0.00							
230									
QC	Memo	0.00							
Quality Control									

Handwritten notes: 1x of all 15/06/04, 1x of all 15/06/04, 10 156-4.

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition			
				Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐
OTHER : ☐					

Work Order ID 133247

133247

Page 10

Thursday, May 28, 2015 7:22:27 AM

Item ID: D119-646-041 Accept *N900040100* Setup Start *NS1*
 Revision ID: U/R - URF15-560 Stop *NS2*
 Item Name: Replacement Skidtube with Wearpads, Fits LH or RH
 Start Date: 5/28/2015 Start Qty: 1.00 *1* Cust Item ID:
 Required Date: 5/28/2015 Req'd Qty: 1.00 *1* Customer:
 Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start *NR1*
 QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop *NR2*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
240		0.00							
240		0.00							
HandFinish	Memo								
Hand Finishing	1-Install wearpads, gaskets as per Dwg D3887. Put sikaflex in insert before installing bolts and washers A/R Sikaflex-240/-291 <u>11131574</u> Sikaflex expire date: <u>1/1/10</u> 2-assemble o'ring to plug as per dwg D3492 and apply o'ring lube A/R 55-o'ring lube batch: <u>11131349</u> RTU 598 11132017 15/02 3 -Inspect for foreign objects as per QSI 024 4 -Install Aft Cap and seal with Sikaflex. Clean excess adhesive. A/R Sikaflex-240/-291 <u>11131574</u> Sikaflex expire date: <u>1/1/10</u>								
245	QC5- Inspect part completeness to step on W/O	0.00							
245		0.00							
QC	Memo								
Quality Control									

DAS
38
9-89

JUN 08 2015

DAS
38
9-89

JUN 08 2015

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐
OTHER : ☐					

Work Order ID 133247

Thursday, May 28, 2015 7:22:27 AM

133247

Page 11

Item ID: D119-646-041 Accept ***N900040100*** Setup Start ***NS1***
 Revision ID: U/R - URF15-560 Stop ***NS2***
 Item Name: Replacement Skidtube with Wearpads, Fits LH or RH
 Start Date: 5/28/2015 Start Qty: 1.00 ***1*** Cust Item ID:
 Required Date: 5/28/2015 Req'd Qty: 1.00 ***1*** Customer:
 Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
 QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
250 *250* HandFinish Hand Finishing	Wing Walk as per dwg QSI005 4.4 Batch <u>113203</u> Memo	0.00				<u>1x</u>	<u>1</u>	<u>15106100</u>	
251 *251* QC Quality Control	QC3- Inspect Part Finish Memo	0.00				<u>1</u>			DAS 38 9-89 JUN 08 2015
260 *260* Packaging Packaging	Identify as per dwg & Stock Location: <u>PP 133164</u> Memo	0.00							DAS 6 9-89 JUN 09 2015

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS <table style="width: 100%; border: none;"> <tr> <td style="border: none;">Skid-tube ☐</td> <td style="border: none;">Cross tube ☐</td> <td style="border: none;">Water Jet ☐</td> <td style="border: none;">Engineering ☐</td> </tr> <tr> <td style="border: none;">Machining ☐</td> <td style="border: none;">Small Fab ☐</td> <td style="border: none;">Prod. Eng. Coord. ☐</td> <td style="border: none;">Quality ☐</td> </tr> <tr> <td style="border: none;">Thermoforming ☐</td> <td style="border: none;">Finishing ☐</td> <td style="border: none;">Rec/Store/Packaging ☐</td> <td style="border: none;">Other ☐</td> </tr> <tr> <td style="border: none;">Large Fab ☐</td> <td style="border: none;">Composite ☐</td> <td style="border: none;">Supplier ☐</td> <td></td> </tr> </table>						Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐																																															
Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐																																																																				
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐																																																																				
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐																																																																				
Large Fab ☐	Composite ☐	Supplier ☐																																																																					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval																																																																
Description Work Order Deviation				Disposition			Completed By																																																																
							Lead hand / Supervisor Approval Verification																																																																
							QC / QA Coordinator Approval																																																																
Root Cause <table style="width: 100%; border: none;"> <tr> <td style="border: none;">Environment ☐</td> <td style="border: none;">No Re-verification ☐</td> </tr> <tr> <td style="border: none;">Design ☐</td> <td style="border: none;">Operator ☐</td> </tr> <tr> <td style="border: none;">Doc/Data ☐</td> <td style="border: none;">Offset/Setup ☐</td> </tr> <tr> <td style="border: none;">Equip/Tooling ☐</td> <td style="border: none;">Supplier ☐</td> </tr> <tr> <td style="border: none;">Handling/Pre ☐</td> <td style="border: none;">Training ☐</td> </tr> <tr> <td style="border: none;">Material ☐</td> <td style="border: none;">Use for Testing ☐</td> </tr> <tr> <td style="border: none;">Internal Transport ☐</td> <td style="border: none;">Poor Information ☐</td> </tr> <tr> <td style="border: none;">Tribal Knowledge ☐</td> <td style="border: none;">Rushing ☐</td> </tr> <tr> <td style="border: none;">LOA ☐</td> <td style="border: none;">Product Improvement ☐</td> </tr> <tr> <td style="border: none;">Substation ☐</td> <td style="border: none;">Process Improvement ☐</td> </tr> <tr> <td style="border: none;">Past Expiry Date ☐</td> <td style="border: none;">Manufacturing Process ☐</td> </tr> <tr> <td style="border: none;">Misidentified ☐</td> <td style="border: none;">Past Due ☐</td> </tr> </table>		Environment ☐	No Re-verification ☐	Design ☐	Operator ☐	Doc/Data ☐	Offset/Setup ☐	Equip/Tooling ☐	Supplier ☐	Handling/Pre ☐	Training ☐	Material ☐	Use for Testing ☐	Internal Transport ☐	Poor Information ☐	Tribal Knowledge ☐	Rushing ☐	LOA ☐	Product Improvement ☐	Substation ☐	Process Improvement ☐	Past Expiry Date ☐	Manufacturing Process ☐	Misidentified ☐	Past Due ☐	FAULT CATEGORY <table style="width: 100%; border: none;"> <tr> <td style="border: none;">Pressure/Forced ☐</td> <td style="border: none;">Temperature/Cure ☐</td> <td style="border: none;">Power Loss/Surge ☐</td> <td style="border: none;">Positioned Wrong ☐</td> </tr> <tr> <td style="border: none;">Bending ☐</td> <td style="border: none;">Set-up ☐</td> <td style="border: none;">Folio/Program ☐</td> <td style="border: none;">Outside Dimensions ☐</td> </tr> <tr> <td style="border: none;">Centre Not Concentric ☐</td> <td style="border: none;">BOM/Route ☐</td> <td style="border: none;">Grain ☐</td> <td style="border: none;">Over/Under tolerance ☐</td> </tr> <tr> <td style="border: none;">Cracks ☐</td> <td style="border: none;">Broken/Damage/Defect ☐</td> <td style="border: none;">Weld ☐</td> <td style="border: none;">Part Incorrect ☐</td> </tr> <tr> <td style="border: none;">Crimp/Kink/Ripple/Wave ☐</td> <td style="border: none;">Inspection Incomplete/Unqualified ☐</td> <td style="border: none;">Wrong Stock Pulled ☐</td> <td style="border: none;">Part Lost/Missing ☐</td> </tr> <tr> <td style="border: none;">Cuffs ☐</td> <td style="border: none;">Contamination ☐</td> <td style="border: none;">Out of Sequence ☐</td> <td style="border: none;">Part Moved ☐</td> </tr> <tr> <td style="border: none;">Crushing ☐</td> <td style="border: none;">Countersink ☐</td> <td style="border: none;">Off-set ☐</td> <td style="border: none;">Drawing ☐</td> </tr> <tr> <td style="border: none;">Heat Treat ☐</td> <td style="border: none;">Cut Too Short ☐</td> <td style="border: none;">Mislabeled ☐</td> <td style="border: none;">Finish ☐</td> </tr> <tr> <td style="border: none;">Wave/Twist in Tube ☐</td> <td style="border: none;">Instructions Incomplete/Unclear ☐</td> <td style="border: none;">Fit/Function ☐</td> <td style="border: none;">Misread ☐</td> </tr> <tr> <td style="border: none;">Marks/Chatter ☐</td> <td style="border: none;">Drill Holes ☐</td> <td style="border: none;">Misaligned/off center ☐</td> <td style="border: none;">Turning Sequence ☐</td> </tr> </table>						Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐
Environment ☐	No Re-verification ☐																																																																						
Design ☐	Operator ☐																																																																						
Doc/Data ☐	Offset/Setup ☐																																																																						
Equip/Tooling ☐	Supplier ☐																																																																						
Handling/Pre ☐	Training ☐																																																																						
Material ☐	Use for Testing ☐																																																																						
Internal Transport ☐	Poor Information ☐																																																																						
Tribal Knowledge ☐	Rushing ☐																																																																						
LOA ☐	Product Improvement ☐																																																																						
Substation ☐	Process Improvement ☐																																																																						
Past Expiry Date ☐	Manufacturing Process ☐																																																																						
Misidentified ☐	Past Due ☐																																																																						
Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐																																																																				
Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐																																																																				
Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐																																																																				
Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐																																																																				
Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐																																																																				
Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐																																																																				
Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐																																																																				
Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐																																																																				
Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐																																																																				
Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐																																																																				
OTHER :																																																																							

Work Order ID 133247

Thursday, May 28, 2015 7:22:27 AM

133247

Page 12

Item ID: D119-646-041

Accept

N900040100Setup Start ***NS1***

Revision ID: U/R - URF15-560

Item Name: Replacement Skidtube with Wearpads, Fits LH or RH

Stop ***NS2***Start Date: 5/28/2015 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 5/28/2015 Req'd Qty: 1.00 ***1***

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

270

QC21- Final Inspection - Work Order Release

0.00

270

QC

Memo

0.00

Quality Control

ML5

JUN 09 2015

ML5

JUN 09 2015

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐
OTHER : ☐					

Picklist Print

Thursday, May 28, 2015 7:22:31 AM

Page 1

Work Order ID: 133247

133247

Parent Item: D119-646-041

D119-646-041

Parent Item Name: Replacement Skidtube with Wearpads, Fits LH or RH

Start Date: 5/28/2015

Required Date: 5/28/2015

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP RevA: New issue DD verified by:EC IPP rev B
10.02.22 per PAR 09-043 EC verified by:DD IPP REVC 12.11.05
(DEOD3887-B-1)(ecn 12-675) DD verf:JLM IPP REV:D 13.03.20 per
chg003 ECN13-534 DD verf:JLM

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
D2500-1-190 *D2500-1-190* Ext'n -I' Beam Tube 4"		Manufactured	No			110	Each	52.0000	1	1			
** 15-6-1													
						<u>Location</u>	<u>Loc Qty</u>	<u>Loc Code</u>					
						LG002	52						
						120085	52						
D2579 *D2579* Crossbolt Spacer		Manufactured	No			140	Each	187.0000	2	2			
** BE15-06-03													
						<u>Location</u>	<u>Loc Qty</u>	<u>Loc Code</u>					
						LG001	187						
						113785	24						
						123997	163						
D2855-3 *D2855-3* Cap		Manufactured	No			240	Each	50.0000	2	2			
** 15/06/04													
						<u>Location</u>	<u>Loc Qty</u>	<u>Loc Code</u>					
						FP001	50						
						111898	10						
						127596	40						

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS <table style="width:100%; border: none;"> <tr> <td style="border: none;">Skid-tube ☐</td> <td style="border: none;">Cross tube ☐</td> <td style="border: none;">Water Jet ☐</td> <td style="border: none;">Engineering ☐</td> </tr> <tr> <td style="border: none;">Machining ☐</td> <td style="border: none;">Small Fab ☐</td> <td style="border: none;">Prod. Eng. Coord. ☐</td> <td style="border: none;">Quality ☐</td> </tr> <tr> <td style="border: none;">Thermoforming ☐</td> <td style="border: none;">Finishing ☐</td> <td style="border: none;">Rec/Store/Packaging ☐</td> <td style="border: none;">Other ☐</td> </tr> <tr> <td style="border: none;">Large Fab ☐</td> <td style="border: none;">Composite ☐</td> <td style="border: none;">Supplier ☐</td> <td></td> </tr> </table>						Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐																																																	
Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐																																																																						
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐																																																																						
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐																																																																						
Large Fab ☐	Composite ☐	Supplier ☐																																																																							
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval																																																																		
Description Work Order Deviation				Disposition				Completed By																																																																	
Root Cause				FAULT CATEGORY																																																																					
<table style="width:100%; border: none;"> <tr><td style="border: none;">Environment ☐</td><td style="border: none;">No Re-verification ☐</td></tr> <tr><td style="border: none;">Design ☐</td><td style="border: none;">Operator ☐</td></tr> <tr><td style="border: none;">Doc/Data ☐</td><td style="border: none;">Offset/Setup ☐</td></tr> <tr><td style="border: none;">Equip/Tooling ☐</td><td style="border: none;">Supplier ☐</td></tr> <tr><td style="border: none;">Handling/Pre ☐</td><td style="border: none;">Training ☐</td></tr> <tr><td style="border: none;">Material ☐</td><td style="border: none;">Use for Testing ☐</td></tr> <tr><td style="border: none;">Internal Transport ☐</td><td style="border: none;">Poor Information ☐</td></tr> <tr><td style="border: none;">Tribal Knowledge ☐</td><td style="border: none;">Rushing ☐</td></tr> <tr><td style="border: none;">LOA ☐</td><td style="border: none;">Product Improvement ☐</td></tr> <tr><td style="border: none;">Substation ☐</td><td style="border: none;">Process Improvement ☐</td></tr> <tr><td style="border: none;">Past Expiry Date ☐</td><td style="border: none;">Manufacturing Process ☐</td></tr> <tr><td style="border: none;">Misidentified ☐</td><td style="border: none;">Past Due ☐</td></tr> </table>				Environment ☐	No Re-verification ☐	Design ☐	Operator ☐	Doc/Data ☐	Offset/Setup ☐	Equip/Tooling ☐	Supplier ☐	Handling/Pre ☐	Training ☐	Material ☐	Use for Testing ☐	Internal Transport ☐	Poor Information ☐	Tribal Knowledge ☐	Rushing ☐	LOA ☐	Product Improvement ☐	Substation ☐	Process Improvement ☐	Past Expiry Date ☐	Manufacturing Process ☐	Misidentified ☐	Past Due ☐	<table style="width:100%; border: none;"> <tr><td style="border: none;">Pressure/Forced ☐</td><td style="border: none;">Temperature/Cure ☐</td><td style="border: none;">Power Loss/Surge ☐</td><td style="border: none;">Positioned Wrong ☐</td></tr> <tr><td style="border: none;">Bending ☐</td><td style="border: none;">Set-up ☐</td><td style="border: none;">Folio/Program ☐</td><td style="border: none;">Outside Dimensions ☐</td></tr> <tr><td style="border: none;">Centre Not Concentric ☐</td><td style="border: none;">BOM/Route ☐</td><td style="border: none;">Grain ☐</td><td style="border: none;">Over/Under tolerance ☐</td></tr> <tr><td style="border: none;">Cracks ☐</td><td style="border: none;">Broken/Damage/Defect ☐</td><td style="border: none;">Weld ☐</td><td style="border: none;">Part Incorrect ☐</td></tr> <tr><td style="border: none;">Crimp/Kink/Ripple/Wave ☐</td><td style="border: none;">Inspection Incomplete/Unqualified ☐</td><td style="border: none;">Wrong Stock Pulled ☐</td><td style="border: none;">Part Lost/Missing ☐</td></tr> <tr><td style="border: none;">Cuffs ☐</td><td style="border: none;">Contamination ☐</td><td style="border: none;">Out of Sequence ☐</td><td style="border: none;">Part Moved ☐</td></tr> <tr><td style="border: none;">Crushing ☐</td><td style="border: none;">Countersink ☐</td><td style="border: none;">Off-set ☐</td><td style="border: none;">Drawing ☐</td></tr> <tr><td style="border: none;">Heat Treat ☐</td><td style="border: none;">Cut Too Short ☐</td><td style="border: none;">Mislabeled ☐</td><td style="border: none;">Finish ☐</td></tr> <tr><td style="border: none;">Wave/Twist in Tube ☐</td><td style="border: none;">Instructions Incomplete/Unclear ☐</td><td style="border: none;">Fit/Function ☐</td><td style="border: none;">Misread ☐</td></tr> <tr><td style="border: none;">Marks/Chatter ☐</td><td style="border: none;">Drill Holes ☐</td><td style="border: none;">Misaligned/off center ☐</td><td style="border: none;">Turning Sequence ☐</td></tr> </table>						Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐
Environment ☐	No Re-verification ☐																																																																								
Design ☐	Operator ☐																																																																								
Doc/Data ☐	Offset/Setup ☐																																																																								
Equip/Tooling ☐	Supplier ☐																																																																								
Handling/Pre ☐	Training ☐																																																																								
Material ☐	Use for Testing ☐																																																																								
Internal Transport ☐	Poor Information ☐																																																																								
Tribal Knowledge ☐	Rushing ☐																																																																								
LOA ☐	Product Improvement ☐																																																																								
Substation ☐	Process Improvement ☐																																																																								
Past Expiry Date ☐	Manufacturing Process ☐																																																																								
Misidentified ☐	Past Due ☐																																																																								
Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐																																																																						
Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐																																																																						
Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐																																																																						
Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐																																																																						
Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐																																																																						
Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐																																																																						
Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐																																																																						
Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐																																																																						
Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐																																																																						
Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐																																																																						
OTHER : ☐																																																																									

Picklist Print

Page 2

Thursday, May 28, 2015 7:22:31 AM

Work Order ID: 133247

133247

Parent Item: D119-646-041

D119-646-041

Parent Item Name: Replacement Skidtube with Wearpads, Fits LH or RH

Start Date: 5/28/2015

Required Date: 5/28/2015

Start Qty: 1.00

Required Qty: 1.00

NAS1611-005

Purchased No

240 Each

314.0000

16

16

NAS1611-005

O-RING

**

ll isloglor

Location

Loc Qty

Loc Code

FP001

314

m129198

75

m129384

239

X16

D3492-5

Manufactured No

240 Each

71.0000

16

16

D3492-5

Plug

**

ll isloglor

Location

Loc Qty

Loc Code

FP001

71

112740

29

120153

42

X16

D3672-1

Manufactured No

240 Each

564.0000

2

2

D3672-1

Washer, Phenolic

**

ll isloglor

Location

Loc Qty

Loc Code

FG

10

85222

10

FP001

196

113581

196

ST055

358

120116

3

127322

355

X2

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval	
Description Work Order Deviation		Disposition			
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : _____					

Picklist Print

Page 3

Thursday, May 28, 2015 7:22:31 AM

Work Order ID: 133247

133247

Parent Item: D119-646-041

D119-646-041

Parent Item Name: Replacement Skidtube with Wearpads, Fits LH or RH

Start Date: 5/28/2015

Required Date: 5/28/2015

Start Qty: 1.00

Required Qty: 1.00

D3681-1

Manufactured No

160

Each

26.0000

8

8

D3681-1

Spacer

**

8E15-0603
8132711 + 8

Location

Loc Qty

Loc Code

LG

21

129061

3

131926

18

LG001

5

123088

5

D3847-1

Manufactured No

240

Each

22.0000

5

5

D3847-1

Wearpad

**

all 15106100

Location

Loc Qty

Loc Code

FP001

22

112444

10

113736

11

88420

1

x5

D3847-11

Manufactured No

240

Each

16.0000

1

1

D3847-11

Wearpad

**

all 15106100

Location

Loc Qty

Loc Code

FP001

16

112558

8

113833

8

✓

D3885-1

Manufactured No

140

Each

7.0000

1

1

D3885-1

Standard Web

**

15-6-1

Location

Loc Qty

Loc Code

LG002

7

129069

7

1

Thursday, May 28, 2015 7:22:31 AM

Shop Packet Print

Page 3

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width:100%; border: none;"> <tr> <td style="border: none;">Skid-tube ☐</td> <td style="border: none;">Cross tube ☐</td> <td style="border: none;">Water Jet ☐</td> <td style="border: none;">Engineering ☐</td> </tr> <tr> <td style="border: none;">Machining ☐</td> <td style="border: none;">Small Fab ☐</td> <td style="border: none;">Prod. Eng. Coord. ☐</td> <td style="border: none;">Quality ☐</td> </tr> <tr> <td style="border: none;">Thermoforming ☐</td> <td style="border: none;">Finishing ☐</td> <td style="border: none;">Rec/Store/Packaging ☐</td> <td style="border: none;">Other ☐</td> </tr> <tr> <td style="border: none;">Large Fab ☐</td> <td style="border: none;">Composite ☐</td> <td style="border: none;">Supplier ☐</td> <td></td> </tr> </table>				Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐																																																																												
Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐																																																																																													
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐																																																																																													
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐																																																																																													
Large Fab ☐	Composite ☐	Supplier ☐																																																																																														
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval																																																																																												
Description Work Order Deviation		Disposition		Completed By																																																																																												
				Lead hand / Supervisor Approval Verification																																																																																												
				QC / QA Coordinator Approval																																																																																												
Root Cause <table style="width:100%; border: none;"> <tr> <td style="border: none;">Environment ☐</td> <td style="border: none;">No Re-verification ☐</td> <td style="border: none;">Pressure/Forced ☐</td> <td style="border: none;">Temperature/Cure ☐</td> <td style="border: none;">Power Loss/Surge ☐</td> <td style="border: none;">Positioned Wrong ☐</td> </tr> <tr> <td style="border: none;">Design ☐</td> <td style="border: none;">Operator ☐</td> <td style="border: none;">Bending ☐</td> <td style="border: none;">Set-up ☐</td> <td style="border: none;">Folio/Program ☐</td> <td style="border: none;">Outside Dimensions ☐</td> </tr> <tr> <td style="border: none;">Doc/Data ☐</td> <td style="border: none;">Offset/Setup ☐</td> <td style="border: none;">Centre Not Concentric ☐</td> <td style="border: none;">BOM/Route ☐</td> <td style="border: none;">Grain ☐</td> <td style="border: none;">Over/Under tolerance ☐</td> </tr> <tr> <td style="border: none;">Equip/Tooling ☐</td> <td style="border: none;">Supplier ☐</td> <td style="border: none;">Cracks ☐</td> <td style="border: none;">Broken/Damage/Defect ☐</td> <td style="border: none;">Weld ☐</td> <td style="border: none;">Part Incorrect ☐</td> </tr> <tr> <td style="border: none;">Handling/Pre ☐</td> <td style="border: none;">Training ☐</td> <td style="border: none;">Crimp/Kink/Ripple/Wave ☐</td> <td style="border: none;">Inspection Incomplete/Unqualified ☐</td> <td style="border: none;">Wrong Stock Pulled ☐</td> <td style="border: none;">Part Lost/Missing ☐</td> </tr> <tr> <td style="border: none;">Material ☐</td> <td style="border: none;">Use for Testing ☐</td> <td style="border: none;">Cuffs ☐</td> <td style="border: none;">Contamination ☐</td> <td style="border: none;">Out of Sequence ☐</td> <td style="border: none;">Part Moved ☐</td> </tr> <tr> <td style="border: none;">Internal Transport ☐</td> <td style="border: none;">Poor Information ☐</td> <td style="border: none;">Crushing ☐</td> <td style="border: none;">Countersink ☐</td> <td style="border: none;">Off-set ☐</td> <td style="border: none;">Drawing ☐</td> </tr> <tr> <td style="border: none;">Tribal Knowledge ☐</td> <td style="border: none;">Rushing ☐</td> <td style="border: none;">Heat Treat ☐</td> <td style="border: none;">Cut Too Short ☐</td> <td style="border: none;">Mislabeled ☐</td> <td style="border: none;">Finish ☐</td> </tr> <tr> <td style="border: none;">LOA ☐</td> <td style="border: none;">Product Improvement ☐</td> <td style="border: none;">Wave/Twist in Tube ☐</td> <td style="border: none;">Instructions Incomplete/Unclear ☐</td> <td style="border: none;">Fit/Function ☐</td> <td style="border: none;">Misread ☐</td> </tr> <tr> <td style="border: none;">Substation ☐</td> <td style="border: none;">Process Improvement ☐</td> <td style="border: none;">Marks/Chatter ☐</td> <td style="border: none;">Drill Holes ☐</td> <td style="border: none;">Misaligned/off center ☐</td> <td style="border: none;">Turning Sequence ☐</td> </tr> <tr> <td style="border: none;">Past Expiry Date ☐</td> <td style="border: none;">Manufacturing Process ☐</td> <td colspan="4"></td> </tr> <tr> <td style="border: none;">Misidentified ☐</td> <td style="border: none;">Past Due ☐</td> <td colspan="4"></td> </tr> </table>		Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐	LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐	Past Expiry Date ☐	Manufacturing Process ☐					Misidentified ☐	Past Due ☐					FAULT CATEGORY <table style="width:100%; border: none;"> <tr> <td style="border: none;">Power Loss/Surge ☐</td> <td style="border: none;">Positioned Wrong ☐</td> </tr> <tr> <td style="border: none;">Folio/Program ☐</td> <td style="border: none;">Outside Dimensions ☐</td> </tr> <tr> <td style="border: none;">Grain ☐</td> <td style="border: none;">Over/Under tolerance ☐</td> </tr> <tr> <td style="border: none;">Weld ☐</td> <td style="border: none;">Part Incorrect ☐</td> </tr> <tr> <td style="border: none;">Wrong Stock Pulled ☐</td> <td style="border: none;">Part Lost/Missing ☐</td> </tr> <tr> <td style="border: none;">Out of Sequence ☐</td> <td style="border: none;">Part Moved ☐</td> </tr> <tr> <td style="border: none;">Off-set ☐</td> <td style="border: none;">Drawing ☐</td> </tr> <tr> <td style="border: none;">Mislabeled ☐</td> <td style="border: none;">Finish ☐</td> </tr> <tr> <td style="border: none;">Fit/Function ☐</td> <td style="border: none;">Misread ☐</td> </tr> <tr> <td style="border: none;">Misaligned/off center ☐</td> <td style="border: none;">Turning Sequence ☐</td> </tr> </table>			Power Loss/Surge ☐	Positioned Wrong ☐	Folio/Program ☐	Outside Dimensions ☐	Grain ☐	Over/Under tolerance ☐	Weld ☐	Part Incorrect ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Out of Sequence ☐	Part Moved ☐	Off-set ☐	Drawing ☐	Mislabeled ☐	Finish ☐	Fit/Function ☐	Misread ☐	Misaligned/off center ☐	Turning Sequence ☐
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐																																																																																											
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐																																																																																											
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐																																																																																											
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐																																																																																											
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐																																																																																											
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐																																																																																											
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐																																																																																											
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐																																																																																											
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐																																																																																											
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐																																																																																											
Past Expiry Date ☐	Manufacturing Process ☐																																																																																															
Misidentified ☐	Past Due ☐																																																																																															
Power Loss/Surge ☐	Positioned Wrong ☐																																																																																															
Folio/Program ☐	Outside Dimensions ☐																																																																																															
Grain ☐	Over/Under tolerance ☐																																																																																															
Weld ☐	Part Incorrect ☐																																																																																															
Wrong Stock Pulled ☐	Part Lost/Missing ☐																																																																																															
Out of Sequence ☐	Part Moved ☐																																																																																															
Off-set ☐	Drawing ☐																																																																																															
Mislabeled ☐	Finish ☐																																																																																															
Fit/Function ☐	Misread ☐																																																																																															
Misaligned/off center ☐	Turning Sequence ☐																																																																																															
OTHER : ☐																																																																																																

Picklist Print

Thursday, May 28, 2015 7:22:31 AM

Page 4

Work Order ID: 133247

133247

Parent Item: D119-646-041

D119-646-041

Parent Item Name: Replacement Skidtube with Wearpads, Fits LH or RH

Start Date: 5/28/2015

Required Date: 5/28/2015

Start Qty: 1.00

Required Qty: 1.00

D3903-1 Manufactured No

160 Each 50.0000 12 12

D3903-1

Spacer

**

8/15/06-03

Location

Loc Qty

Loc Code

LG

47

132881

47

12

LG001

3

124312

3

ALS4-1032-130 AELS4-1032-130 Purchased No

220 Each 2,955.0000 30 30

ALS4-1032-130

Rivnut

**

all 15/06/04

Location

Loc Qty

Loc Code

CA

5

M128649

5

st549

2950

M132317

2950

X30

AN3C5A Purchased No

240 Each 452.0000 32 32

AN3C5A

Bolt

**

all 15/06/04

Location

Loc Qty

Loc Code

FG

5

122800

5

FP001

6

M131420

6

ST

56

121708

56

ST338a

376

M130851

16

M131803

360

X32

ST350

9

M131320

9

P.T.O.

DQA:

Date:

15/06/30

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed:

Date:

Work Order update only



Work Order: <u>133247</u> Part No. <u>D119-646-041</u> NCR No.		DISPOSITION Rework ☒ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS <table style="width:100%;"> <tr> <td>Skid-tube ☐</td> <td>Cross tube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☒</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>				Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☒	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐																																																	
Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐																																																																				
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐																																																																				
Thermoforming ☐	Finishing ☒	Rec/Store/Packaging ☐	Other ☐																																																																				
Large Fab ☐	Composite ☐	Supplier ☐																																																																					
Date : <u>15.06.03</u>		Step #: <u>240</u>		QTY Effective :		MRB (QSI042) Approval <u>A.P.</u> <u>15.06.03</u>																																																																	
Description Work Order Deviation <u>UNUSED WEARPLATE HOLES (RIUNUS) SHOULD BE PLUGGED WITH AN3C4A BOLTS QTY 6</u>				Disposition <u>ACCEPTABLE</u> <u>AN3C-4A / M132189 (x4)</u>		Completed By <u>JL 15/06/03</u> Lead hand / Supervisor Approval Verification DAS 9 9-89 <u>1506-16</u> QC / QA Coordinator Approval DAS 9 9-89 <u>1506-16</u>																																																																	
Root Cause <table style="width:100%;"> <tr> <td>Environment ☐</td> <td>No Re-verification ☐</td> </tr> <tr> <td>Design ☒</td> <td>Operator ☐</td> </tr> <tr> <td>Doc/Data ☒</td> <td>Offset/Setup ☐</td> </tr> <tr> <td>Equip/Tooling ☐</td> <td>Supplier ☐</td> </tr> <tr> <td>Handling/Pre ☐</td> <td>Training ☐</td> </tr> <tr> <td>Material ☐</td> <td>Use for Testing ☐</td> </tr> <tr> <td>Internal Transport ☐</td> <td>Poor Information ☐</td> </tr> <tr> <td>Tribal Knowledge ☐</td> <td>Rushing ☐</td> </tr> <tr> <td>LOA ☐</td> <td>Product Improvement ☐</td> </tr> <tr> <td>Substation ☐</td> <td>Process Improvement ☐</td> </tr> <tr> <td>Past Expiry Date ☐</td> <td>Manufacturing Process ☐</td> </tr> <tr> <td>Misidentified ☐</td> <td>Past Due ☐</td> </tr> </table>				Environment ☐	No Re-verification ☐	Design ☒	Operator ☐	Doc/Data ☒	Offset/Setup ☐	Equip/Tooling ☐	Supplier ☐	Handling/Pre ☐	Training ☐	Material ☐	Use for Testing ☐	Internal Transport ☐	Poor Information ☐	Tribal Knowledge ☐	Rushing ☐	LOA ☐	Product Improvement ☐	Substation ☐	Process Improvement ☐	Past Expiry Date ☐	Manufacturing Process ☐	Misidentified ☐	Past Due ☐	FAULT CATEGORY <table style="width:100%;"> <tr> <td>Pressure/Forced ☐</td> <td>Temperature/Cure ☐</td> <td>Power Loss/Surge ☐</td> <td>Positioned Wrong ☐</td> </tr> <tr> <td>Bending ☐</td> <td>Set-up ☐</td> <td>Folio/Program ☐</td> <td>Outside Dimensions ☐</td> </tr> <tr> <td>Centre Not Concentric ☐</td> <td>☒ BOM/Route</td> <td>Grain ☐</td> <td>Over/Under tolerance ☐</td> </tr> <tr> <td>Cracks ☐</td> <td>Broken/Damage/Defect ☐</td> <td>Weld ☐</td> <td>Part Incorrect ☐</td> </tr> <tr> <td>Crimp/Kink/Ripple/Wave ☐</td> <td>Inspection Incomplete/Unqualified ☐</td> <td>Wrong Stock Pulled ☐</td> <td>Part Lost/Missing ☐</td> </tr> <tr> <td>Cuffs ☐</td> <td>Contamination ☐</td> <td>Out of Sequence ☐</td> <td>Part Moved ☐</td> </tr> <tr> <td>Crushing ☐</td> <td>Countersink ☐</td> <td>Off-set ☐</td> <td>Drawing ☐</td> </tr> <tr> <td>Heat Treat ☐</td> <td>Cut Too Short ☐</td> <td>Mislabeled ☐</td> <td>Finish ☐</td> </tr> <tr> <td>Wave/Twist in Tube ☐</td> <td>Instructions Incomplete/Unclear ☐</td> <td>Fit/Function ☐</td> <td>Misread ☐</td> </tr> <tr> <td>Marks/Chatter ☐</td> <td>Drill Holes ☐</td> <td>Misaligned/off center ☐</td> <td>Turning Sequence ☐</td> </tr> </table>				Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	Centre Not Concentric ☐	☒ BOM/Route	Grain ☐	Over/Under tolerance ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐
Environment ☐	No Re-verification ☐																																																																						
Design ☒	Operator ☐																																																																						
Doc/Data ☒	Offset/Setup ☐																																																																						
Equip/Tooling ☐	Supplier ☐																																																																						
Handling/Pre ☐	Training ☐																																																																						
Material ☐	Use for Testing ☐																																																																						
Internal Transport ☐	Poor Information ☐																																																																						
Tribal Knowledge ☐	Rushing ☐																																																																						
LOA ☐	Product Improvement ☐																																																																						
Substation ☐	Process Improvement ☐																																																																						
Past Expiry Date ☐	Manufacturing Process ☐																																																																						
Misidentified ☐	Past Due ☐																																																																						
Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐																																																																				
Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐																																																																				
Centre Not Concentric ☐	☒ BOM/Route	Grain ☐	Over/Under tolerance ☐																																																																				
Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐																																																																				
Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐																																																																				
Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐																																																																				
Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐																																																																				
Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐																																																																				
Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐																																																																				
Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐																																																																				
OTHER :																																																																							

Picklist Print

Thursday, May 28, 2015 7:22:31 AM

Page 5

Work Order ID: 133247

133247

Parent Item: D119-646-041

D119-646-041

Parent Item Name: Replacement Skidtube with Wearpads, Fits LH or RH

Start Date: 5/28/2015

Required Date: 5/28/2015

Start Qty: 1.00

Required Qty: 1.00

NAS1149C0332R

Purchased

No

Each

6,655.000

32

NAS1149C0332R

WASHER

Location

Loc Qty

Loc Code

FP001

2140

m130325

2140

GA

430

m131618

430

ST260a

16

m131697

16

ST271

4069

m132262

4069

Each

99.0000

2

MS24694-C52

Purchased

No

MS24694-C52

SCREW

Location

Loc Qty

Loc Code

FP001

53

m127059

53

ST287

46

124308

46

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐
OTHER : _____					

8

7

6


5

4

3

2

1

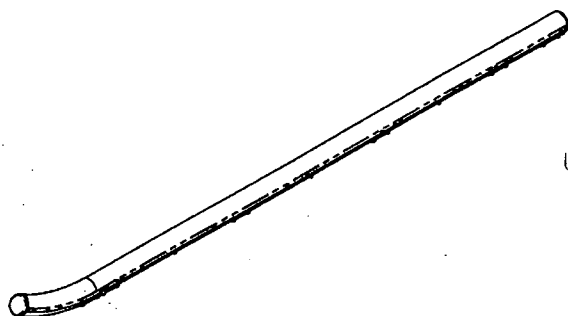

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT

WORK ORDER
NO. 133247.MLS
15-05-28

D3887-041 STANDARD SKIDTUBE ASSY WITH WEARPAD (SHOWN)
D3887-043 STANDARD SKIDTUBE ASSY WITH WEAPLATE (SIMILAR)
D3887-045 STANDARD SKIDTUBE ASSY WITH TRAINING WEARPLATE (SIMILAR)

ITEM	QTY -041	QTY -043	QTY -045	P/N	DESCRIPTION
1	X			D3887-041	STD SKIDTUBE ASSY WITH WEARPAD
2		X		D3887-043	STD SKIDTUBE ASSY WITH WEARPLATE
3			X	D3887-045	STD SKIDTUBE ASSY WITH TRAINING WEARPLATE
10	2	2	2	D2579	CROSS BOLT SPACER
11	2	2	2	D2855-3	CAP
12	16	16		D3492-045	PLUG ASSY
13	2	2	2	D3872-1	PHENOLIC WASHER
14	8	8	8	D3681-1	SPACER
17	5	5		D3847-1	WEARPAD
18	1	1		D3847-11	AFT WEARPAD
19		1		D3847-043	FWD WEARPLATE ASSY
20		1		D3847-045	CENTER WEARPLATE ASSY
21		1		D3847-047	AFT WEARPLATE ASSY
22			1	D3849-041	FWD TRAINING WEARPLATE ASSY
23			1	D3849-043	AFT WEARPLATE ASSY
24	1	1	1	D3885-1	STANDARD WEB
25	1	1		D3887-11	STANDARD SKIDTUBE
26			1	D3887-13	STANDARD SKIDTUBE
27	12	12	12	D3803-1	SPACER
28			18	D3804-1	WASHER
41	30	30		AL84-1032-130	INSERT
42	32	32	2	AN3C5A	BOLT
43			8	AN3C46A	BOLT
44	32	32		NAS1149C0332R	WASHER (OR AN960C10L)
45			8	MS21043-3	NUT
46	2	2	2	MS24694-C52	SCREW

RELEASED

2014 NOV 24

ECN 14-628

UNDER REVIEW

15.04.30 URF15-560 AP

NOTES:

- 1) MATERIAL: N/A
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1 PRIOR TO INSERTING D3885-1 WEB
POWDER COAT "WHITE" (4.3.5.1) PER DART QSI 005 4.3
BLACK ANTI-SKID PAINT AS INDICATED TO 0.5 ABOVE LOCATION RIDGE PER DART QSI 005 4.4
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX
- 6) IDENTIFICATION: NONE
- 7) WEIGHT: D3887-041 = 32.0 lbs
D3887-043 = 37.0 lbs
D3887-045 = 38.1 lbs
- 8) WELD PER DART QSI 004
- 9) DAMAGE TOLERANCE ON FWD BEND:
THERE SHOULD BE NO VISIBLE WRINKLES IN THE BEND FROM THE GROUND TO A HEIGHT OF 8.5 INCHES ABOVE THE GROUND. IT IS ACCEPTABLE TO POLISH OUT GOUGES UP 0.020" DEEP IN THE BENT PORTION OF THE TUBE. A MAXIMUM REDUCTION IN DIAMETER OF 0.150" IS ACCEPTABLE IN THE BENT PORTION OF THE TUBE.
- 10) INSERT D3885-1 WEB TO LOCATION SHOWN OFF AFT END OF SKIDTUBE AND BOND WEB INTO OUTER TUBE WITH SIKAFLEX-241/-291 ADHESIVE PER DART QSI 015 BEFORE BENDING. ENSURE HOLES LINE-UP
- 11) INSERT D3492-045 PLUG ASSY INTO Ø0.197 HOLES (BOTH SIDES OF TUBE)
- 12) USE DART DRILL TEMPLATE DT8931 TO LOCATE AND DRILL Ø0.297 HOLES FOR WEARPLATE INSERTS. INSTALL AELS-1032-130 INTO D3887-11 ONLY. INSTALL AN3C5A BOLTS AND NAS1149C0332R WASHERS WITH SIKAFLEX-241/-291.

D	REVISED BEND TOLERANCES FOR MANUFACTURABILITY, 135.07 WAS 134.04 (ZN D5-8), ADD 5.07 (ZN C2-8), ADD 116.8 (ZN D5-8), DELETE GASKETS (BOM, SH2)	DB	13.09.20
C	(SHT1) PL ZN C2-2, C2-2, C4-2 ITEM 13, QTY 2 WAS 4, ITEM 42, QTY 32 WAS 34, ITEM 44, QTY 30 WAS 32, ADD ITEM 46, MS24694-C52 WAS AN3C5A, 2 PLCS (ZN C1-5, C1-6, B4-7) Ø0.201 CSK Ø0.385 X 1.00" WAS Ø0.214 THRU, ADDED DETAIL F (ZN C8-5, C8-6, B8-7), ADD ITEM 10, D2579 CROSS BOLT SPACER (ZN C4-1, A8-7)	DB	13.02.19
B	AL84-1032-130 WAS AELS-1032-130 (ZN C4-1, C5-7, C3-7); ADD DT8931 (ZN A8-1); ADD 134.04 (ZN C4-8); D2855-3 WAS D2579 (ZN D4-1, C7-2, C2-2, C7-3, C2-3, C7-4, C2-4); AN3C5A WAS AN3C4A (ZN C8-2, C2-2, C8-3, C2-3, C4-4, C2-4); Ø0.313 WAS Ø0.328 (ZN C4-5, C4-6, C2-7 & B3-7) REVISED NOTE N (ZN B3-7)	RF	09.06.30
A	NEW ISSUE	RF	09.03.30
REV.	DESCRIPTION	BY	DATE
DESIGN	RF	DART AEROSPACE USA, INC.	
DRAWN	DB	KENT, WA	
CHECKED		DRAWING NO.	REV. D
MFG. APPR.		D3887	SHEET 1 OF 8
APPROVED		TITLE	SCALE
DE APPR.		A119 STD SKIDTUBE ASSY	NTS
DATE	13.09.20	COPYRIGHT © 2009 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED IN ANY MANNER WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

AN3C5A BOLT
D3872-1 PHENOLIC WASHER
NAS1149C0332R WASHER
(1 PER SIDE)

SEAL WITH
SIKAFLEX-241/291

D2855-3 CAP

D3847-11
WEARPAD

AN3C5A BOLT
NAS1149C0332R WASHER
24 PL

BLACK ANTI-SKID TO 0.5
ABOVE LOCATION RIDGE
TYP

11
Ø0.197
8 PL PER SIDE
REF

PLUG UNUSED INSERTS WITH
AN3C5A BOLT
NAS1149C0332R WASHER
8 PL

AN3C4A BOLTS
QTY 6

A.P.
15.06.03

D3847-1
WEARPAD
5 PL

D2855-3 CAP

SEAL WITH
SIKAFLEX-241/291

MS24694-C52 SCREW
(1 PER SIDE)

D3887-041 STANDARD SKIDTUBE ASSY WITH WEARPAD
(MAKE FROM D3887-11)

UNDER REVIEW

15.04.30 URF15-560 AP

RELEASED

2014 NOV 24 *q*

DESIGN	RF	DART AEROSPACE USA, INC.	
DRAWN	DB	KENT, WA	
CHECKED		DRAWING NO.	REV. D
MFG. APPR.		D3887	SHEET 2 OF 8
APPROVED		TITLE	SCALE
DE APPR.		A119 STD SKIDTUBE ASSY	NTS
DATE	13.09.20	COPYRIGHT © 2008 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PROPRIETARY AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

AN3C5A BOLT
D3872-1 PHENOLIC WASHER
NAS1149C0332R WASHER
(1 PER SIDE)

SEAL WITH
SIKAFLEX-241/291

D2855-3 CAP

D3847-11
WEARPAD

D3847-047
AFT WEARPLATE ASSY

AN3C5A BOLT
NAS1149C0332R WASHER
30 PL

D3847-045
CENTER WEARPLATE ASSY

D3847-043
FWD WEARPLATE ASSY

D3847-1
WEARPAD
5 PL

BLACK ANTI-SKID TO 0.5
ABOVE LOCATION RIDGE
TYP

11
Ø0.197
8 PL PER SIDE
REF

D2855-3 CAP

SEAL WITH
SIKAFLEX-241/291

MS24684-C52 SCREW
(1 PER SIDE)

D3887-043 STANDARD SKIDTUBE ASSY WITH WEARPLATE
(MAKE FROM D3887-11)

UNDER REVIEW

15.04.30 URF15-560 AP

RELEASED

2014 NOV 24

DESIGN	RF	DART AEROSPACE USA, INC.	
DRAWN	DB	KENT, WA	
CHECKED		DRAWING NO.	REV. D
MFG. APPR.		D3887	SHEET 3 OF 8
APPROVED		TITLE	SCALE
DE APPR.		A119 STD SKIDTUBE ASSY	NTS
DATE	13.09.20	COPYRIGHT © 2009 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR DISCLOSED OR REPRODUCED IN ANY MANNER WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

AN3C5A BOLT
D3872-1 PHENOLIC WASHER
NAS1149C0332R WASHER
(1 PER SIDE)

SEAL WITH
SIKAFLEX-241/291

D2855-3 CAP

AN3C46A BOLT
D3904-1 WASHER, 2 PL
MS21043-3 NUT
8 PL

D3849-043
AFT TRAINING WEARPLATE ASSY

BLACK ANTI-SKID TO 0.5
ABOVE LOCATION RIDGE
TYP

1.5
1.5
1.5

2.00 DISTANCE TO D3885-1 WEB

1.5
1.5

D2855-3 CAP

SEAL WITH
SIKAFLEX-241/291

MS24694-C52 SCREW
(1 PER SIDE)

D3849-041
FWD TRAINING WEARPLATE ASSY

UNDER REVIEW


15.04.30 URF15-560 AP

RELEASED

2014 NOV 24 *dp*

D3887-045 STANDARD SKIDTUBE ASSY WITH TRAINING WEARPLATE
(MAKE FROM D3387-13)

DESIGN	RF	DART AEROSPACE USA, INC.	
DRAWN	DB	KENT, WA	
CHECKED	<i>[Signature]</i>	DRAWING NO.	REV. D
MFG. APPR.	<i>[Signature]</i>	D3887	SHEET 4 OF 8
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	A119 STD SKIDTUBE ASSY	NTS
DATE	13.09.20	COPYRIGHT © 2008 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSES OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

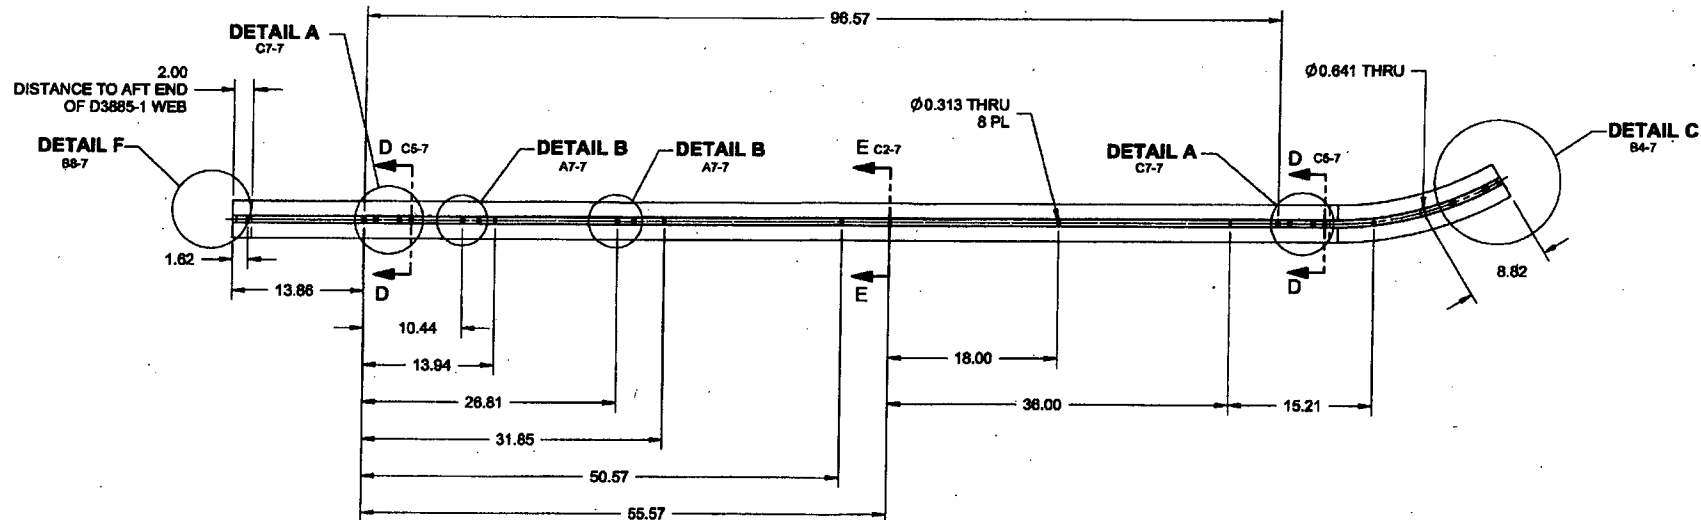

D3887-13 DRILLING DETAIL
(MAKE FROM D3887-1)


UNDER REVIEW

15.04.30 URF15-560 AP

RELEASED

2014 NOV 24 *up*

DESIGN	RF	DART AEROSPACE USA, INC.	
DRAWN	DB	KENT, WA	
CHECKED	<i>[Signature]</i>	DRAWING NO.	REV. D
MFG. APPR.	<i>[Signature]</i>	D3887	SHEET 8 OF 8
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	A119 STD SKIDTUBE ASSY	NTS
DATE	13.09.20	COPYRIGHT © 2009 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED IN ANY FORM OR BY ANY MEANS WITHOUT THE WRITTEN PERMISSION OF DART AEROSPACE USA, INC.	



13) AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR Ø0.375 HOLES ONLY:

- i) CHAMFER HOLES Ø0.475 x 45°
- ii) INSERT D3903-1 SPACER
- iii) WELD INTO PLACE AND GRIND FLUSH
- iv) CBORE TO 0.313 x 0.75 DEEP
- v) DEBURR HOLES

14) AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR Ø0.313 HOLES ONLY:

- vi) CHAMFER HOLES Ø0.354 x 45° OR 0.050 DEEP x 45° (BOTH SIDES)
- vii) INSERT D3681-1 SPACER
- viii) WELD INTO PLACE AND GRIND FLUSH
- ix) DEBURR HOLES


UNDER REVIEW

15.04.30 URF15-560 AP

RELEASED

2014 NOV 24 4P

DESIGN	RF	DART AEROSPACE USA, INC.	
DRAWN	DS	KENT, WA	
CHECKED	<i>[Signature]</i>	DRAWING NO.	REV. I
MFG. APPR.	<i>[Signature]</i>	D3887	SHEET 7 OF 7
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	A119 STD SKIDTUBE ASSY	NTS
DATE	13.09.20	COPYRIGHT © 2009 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL. THAT THE DRAWING, SPECIFICATION, PART OR IS NOT TO BE USED FOR ANY PURPOSE OR REPRODUCED IN ANY MANNER TO ANY OTHER PERSON WITHOUT THE WRITTEN PERMISSION OF DART AEROSPACE USA, INC.	

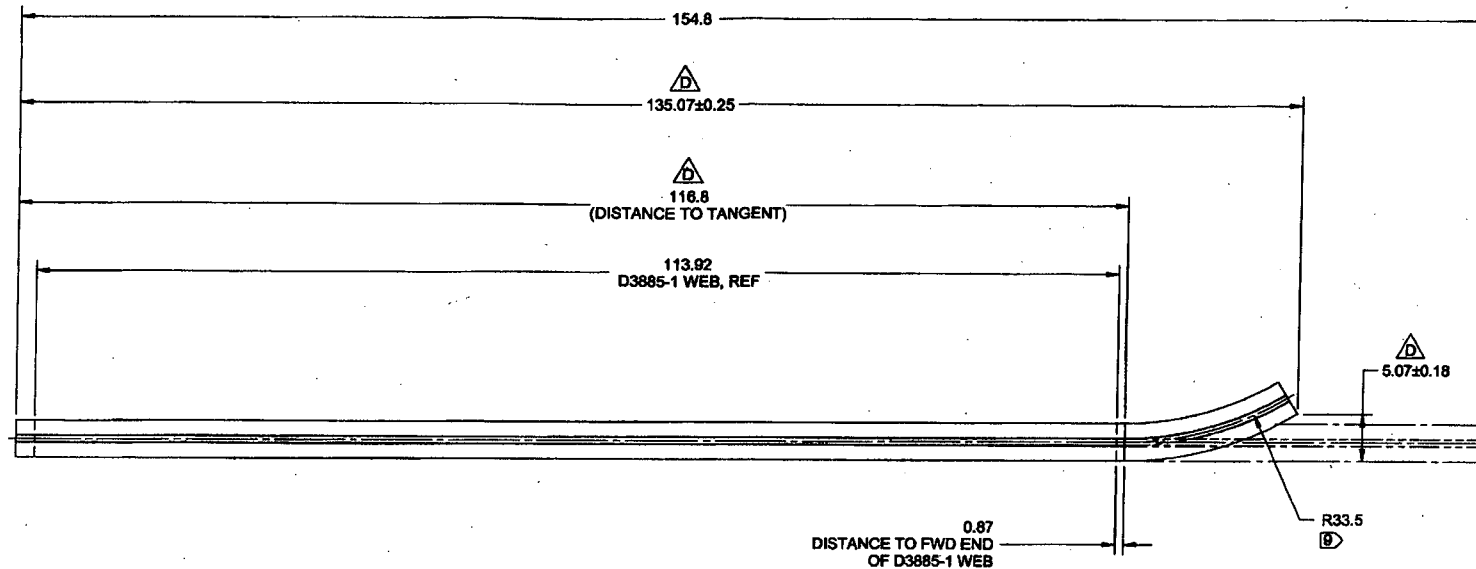


UNDER REVIEW

15.04.30 URF15-560 AP

RELEASED


2014 NOV 24 *qp*

DESIGN	RF	DART AEROSPACE USA, INC.	
DRAWN	DB	KENT, WA	
CHECKED	<i>[Signature]</i>	DRAWING NO.	REV. D
MFG. APPR.	<i>[Signature]</i>	D3887	SHEET 8 OF 8
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	A119 STD SKIDTUBE ASSY	NTS
DATE	13.09.20	COPYRIGHT © 2008 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION OF DART AEROSPACE USA, INC.	

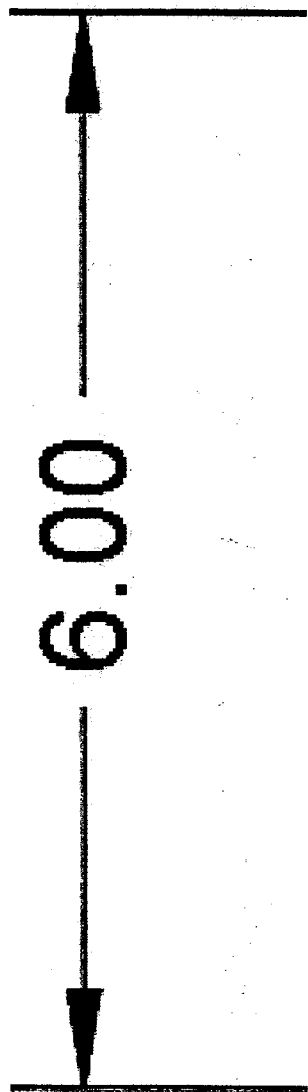

6.00

A.P.
15.03.29

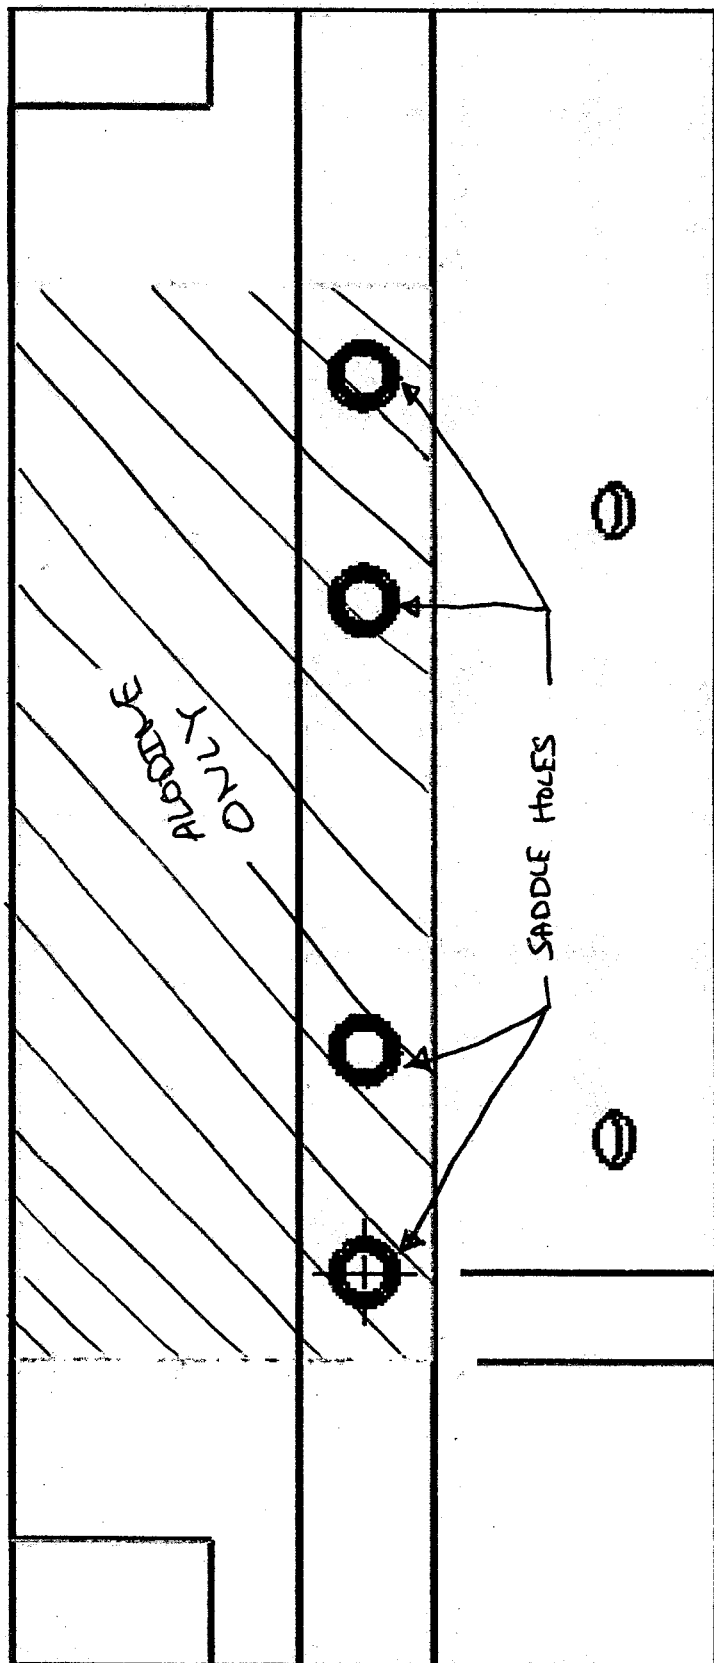

SADDLE HOLES

ALUMINUM
ONLY



0.50